
Characterization of Surface and Sub-Surface Defects in Optical Materials Using the Near Field Evanescent Wave

M. Yan, S. Oberhelman, L. Wang, W. Siekhaus and M. Kozlowski

This paper was prepared for submittal to 5th International Conference on Near Field Optics and Related Theoriques (NFO-5) Shirahama, Japan December 6-10, 1998

September 17, 1998

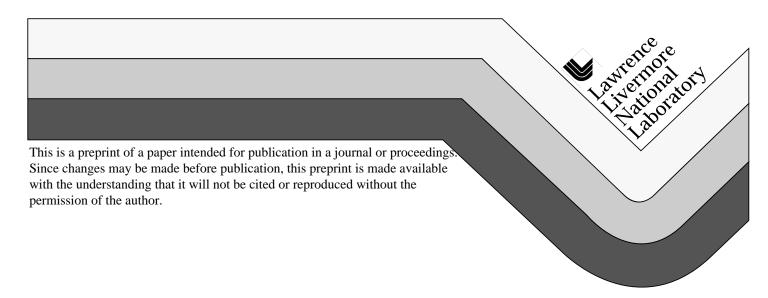

DISCLAIMER

This document was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor the University of California nor any of their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or the University of California. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or the University of California, and shall not be used for advertising or product endorsement purposes.

CHARACTERIZATION OF SURFACE AND SUB-SURFACE DEFECTS IN OPTICAL MATERIALS USING THE NEAR FIELD EVANESCENT WAVE

Ming Yan, Stanley Oberhelman, Li Wang, Wigbert Siekhaus, and Mark Kozlowski

Lawrence Livermore National Laboratory, L-250, Livermore, CA 94551, USA phone: 925-423-1608 fax: 925-422-3361 e-mail: yan1@llnl.gov

KEY WORDS: Near field optics, characterization of surface and sub-surface defects, evanescent wave, laser induced damage, fused silica, and optical coatings.

1. INTRODUCTION

Optical properties of sub-micron defects at and near the surface are of interest in many applications, e.g. in high power laser systems where initiation of laser induced damage is a critical issue. In-situ scanning atomic force microscopy (AFM) has been used previously to establish a direct correlation between a particular structural surface inhomogeneity (such as a nodular defect in coatings) and the initiation of local laser damage at that inhomogeneity¹. Near field scanning optical microscopy (NSOM) make it now possible to provide information on both morphology and optical properties of localized defects at and near the surface²⁻³. As a consequence of these developments one can now test the correlation between local optical properties and laser surface damage.

2. EXPERIMENTAL RESULTS AND CONCLUSIONS

In this paper, we characterize surface and sub-surface defects in fused silica and optical coatings using the surface evanescent wave measured by NSOM implemented on a large-stage AFM. A laser irradiates the sample surface in a total internal reflection configuration. The evanescent wave from the surface is collected by an apertured fiber probe of the NSOM. The amplitude of the surface evanescent wave is proportional to the laser intensity at the surface and therefore sensitive to surface as well as sub-surface defects located in the near-field range (~ 100nm). This subsurface region is thought to contain the great majority of polishing-induced defects. The apertured near field fiber probe provides a spatial resolution of ~100nm and the large stage AFM makes it possible to locate defects in samples with diameters up to 6". We are thus able to map out surface-as well as near-surface optical defects in a large optic, as shown in figure 1, as a first step in understanding laser damage mechanisms. These observed defects will be exposed in situ to high fluence laser light to correlate with the initiation of laser damage. We have also used NSOM to measure in situ the effect of chemical etching on optical properties of

defects. Post-processing such as chemical etching performed after mechanical polishing is frequently used, and sometimes increases laser damage thresholds.

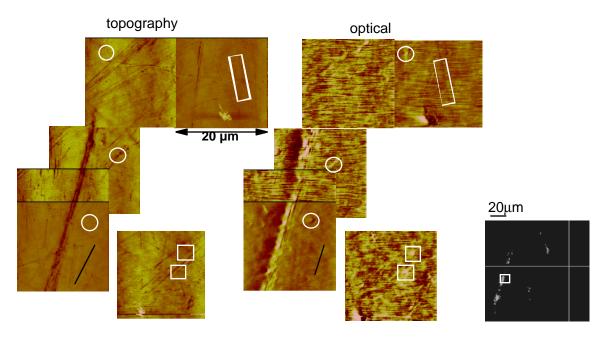


Figure 1. Topographic NSOM images (left) and optical evanescent wave NSOM images (middle) of a large area (each image is $20\mu m$ square) of a polished fused silica surface. The image at the right (shown for comparison) is a conventional total internal reflection image.

We have measured the amplitude variation of the near field evanescent wave around nodular defects and sub-surface inclusions in optical coatings and thus detected local laser field intensification. The observed intensity variation of the evanescent wave agrees with theoretical calculations of laser amplification around the inclusion. These findings support the theory that laser damage may be induced by local electrical field enhancement associated with micron and sub-micron defects.

3. REFERENCES

- [1] R. J. Tench, R. Chow, and M. R. Kozlowski, "Characterization of defect geometries in multilayer optical coatings" J. Vac. Sci. and Tech. A 12/5, 2808 (1994)
- [2] L. Wang, M. Yan, W. Siekhaus, and Stanley Oberhelman "Probing nanodefects in fused silica by near field scanning optical microscopy" J. Appl. Phys. Vol.84, N6, 1998.
- [3] M. Yan, L. Wang, W.J. Siekhaus, M.R. Kozlowski, J. Yang, U. Mohideen "Defects studies in fused silica using near field scanning optical microscopy" SPIE 3244, 268(1997)

4. ACKNOWLEDGMENT

This work was performed under the auspices of the US Department of Energy by Lawrence Livermore National Laboratory under contract No. W-7405-ENG-48.